



PlumbMaster, Inc.




NEW PRODUCT

Insta-Clamp™

THE SOLDER JOINT LEAK REPAIR CLAMP FOR COPPER PIPE

- Eliminates Shutdowns
- Works On Type M, L or K Copper
- Temperature Range: -40° to 212° F
- Simple Two Piece, One Bolt Design
- Installs in Minutes
- Works for Pin-Hole Leaks and Leaks at the Solder Joint
- Available in 1/2" to 4" Sizes
- Made in USA

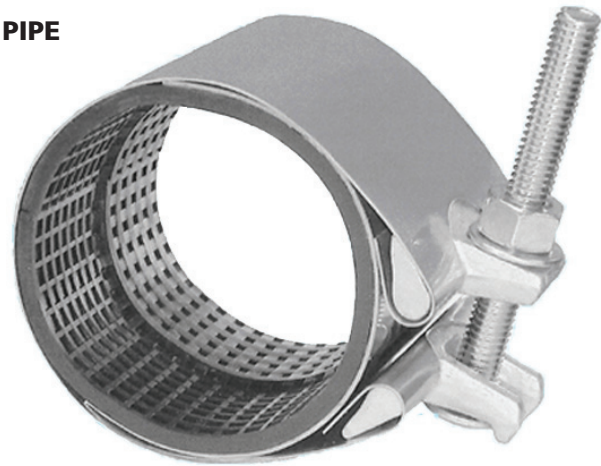

Cat. No.	Pipe Size	OEM Ref. No.
58000	1/2"	416-03-063
58001	3/4"	416-03-088
58002	1"	416-03-113
58003	1-1/4"	416-03-138
58004	1-1/2"	416-03-163
58005	2"	416-03-213
58006	2-1/2"	416-03-263
58007	3"	416-03-313
58008	4"	416-03-413



Leak at solder joint in copper pipe



Insta-Clamp™ repair seals leak

SPECIFICATIONS:

Panel: Stainless Steel Type 304

Bridge Plate: Stainless Steel Type 304

Gasket: Molded Step Waffle NBR Gasket Design

Temperature Range: -40° to 212° F

Pressure: Rated at 150 PSI

Lugs: Ductile Iron per ASTM A536 with Galvanized Plating Finish

Bolt and Nut: Zinc-Chromate Finished Carriage Bolt, Nut and Washer

INSTALLATION INSTRUCTIONS ON REVERSE ►

Phone: **1-800-523-5130** • Fax: **1-800-338-1867** • www.plumbmaster.com



PlumbMaster, Inc.



Insta-Clamp™ **INSTALLATION INSTRUCTIONS**

Please clean pipe and solder joint area thoroughly before installing the Insta-Clamp™

(Fully lubricating gasket with soapy water will assist in reducing friction and help to evenly distribute the clamp on the pipe during installation.)

(*** Lightly lube the 4.00" Insta-Clamps between nut and washer to prevent binding ***)



Leak at solder joint in copper pipe




Loosen the bolt and separate the two parts of the clamp.
Snap top half of clamp with rubber directly over leak



With arrows facing solder joint,
slide over until flush with coupling



Spread open bottom section of clamp with nut facing out and slide on bottom half of clamp over top rubber section with arrows visible in the opening of bottom section.

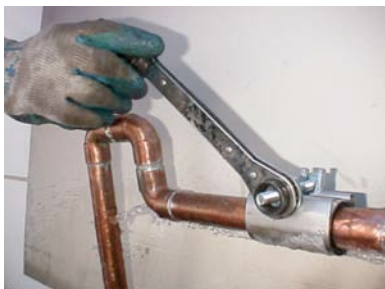

Tighten bolt



Retighten after 20 minutes...Leak is stopped!



Phone: **1-800-523-5130** • Fax: **1-800-338-1867** • www.plumbmaster.com